

# V-1052C INSTALLATION INSTRUCTIONS


### INTRODUCTION

The interior wall speaker, the V-1052C, is a 8" Speaker/Amplifier Assembly capable of reproducing paging as well as back ground music. This speaker has an externally accessible volume control located behind the grille and is screwdriver adjustable. The enclosures are made of steel with a durable powder coated finish. The color of the enclosures can easily be changed to match any decor. A cloth covered detachable grille is included. The speaker requires -24VDC, 50mA (1 power unit).

### MOUNTING

Remove the screw holding the mounting bracket to the enclosure. Mount the bracket using appropriate hardware such as #8 pan head crews. After making the required connections, reattach the enclosure to the mounting bracket.

## INSTALLATION

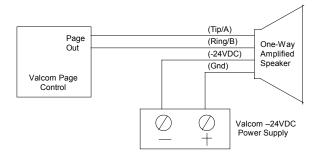

#### **Typical Connections**

NOTE: Do not connect this speaker directly to a 25/70/100 Volt amplifier as damage to both the amplifier and speaker may occur. A V-1095 may be used to allow the use of Valcom self-amplified speakers on 70 Volt speaker lines.



V-1052C Amplified Wall Mount Speaker Gray w/Black Grille

### **DIMENSIONS/WEIGHT**

- 10.13" H x 12.31" W x 4.63" D (25.73cm x 31.27cm W x 11.75cm D)
- Weight: 4.25 LBS (1.91 kg)

### COVERAGE

The area covered by a wall speaker is typically 600 square feet.

#### Number of Speakers per Audio Run

Wire Run (Feet)	22 AWG	24 AWG
400	100	60
800	50	30
1600	25	15

#### Number of Speakers per Power Run

1 Watt Interiors Speakers	22 AWG	24 AWG
30	200 Feet	125 Feet
15	400 Feet	250 Feet
7	800 Feet	500 Feet

### **TECHNICAL ASSISTANCE**

Assistance in troubleshooting is available from the factory. When calling, you should have a VOM, a telephone test set and call from the job site. Call (540) 563-2000 and press 1 for Technical Support or visit our website at http://www.valcom.com. Valcom equipment is not field repairable. Valcom, Inc. maintains service facilities in Roanoke, VA. Should repairs be necessary, attach a tag to the unit clearly stating company name, address, phone number, contact person and the nature of the problem. Send the unit to:

> Valcom, Inc. Repair and Return Dept. 5614 Hollins Road Roanoke, VA 24019

TROUBLESHOOTING CHART			
SYMPTOM		ACTION	
1.	No audio from	1a. Check that volume control is turned up (clockwise).	
	speaker.	<ol> <li>Using a lineman's test set check for the proper audio level on the Tip and Ring leads and if necessary also at the source.</li> </ol>	
2.	Low volume from	2a. Check that volume control is turned up.	
	speaker.	2b. Check voltage at the speaker assembly when in use, -18 to -24VDC required.	
		2c. Using a lineman's test set, check for the proper audio level on Tip and Ring leads. It is possible that some low-level audio will be heard with only one side of Tip and Ring connected.	
3.	Loud squeal	3a. Turn down (counter-clockwise) volume of the speaker.	
	(feedback).	3b. Increase the distance between the telephone and speaker.	
		3c. Install a noise canceling handset on the telephone in severe problem	
		areas.	
		3d. Add a V-9964 Stacking Feedback Eliminator.	

#### VALCOM LIMITED WARRANTY

Valcom, Inc. warrants its products to be free from defects in materials and workmanship under conditions of normal use and service for a period of one year from the date of shipment. The obligation under this warranty shall be limited to the replacement, repair or refund of any such defective device within the warranty period, provided that:

- 1. inspection by Valcom, Inc. indicates the validity of the claim;
- 2. the defect is not the result of damage, misuse or negligence after the original shipment;
- 3 the product has not been altered in any way or repaired by others and that factory sealed units are unopened (a service charge plus parts and labor will be applied to units defaced or physically damaged);
- freight charges for the return of products to Valcom are prepaid;
- 5 all units 'out of warranty' are subject to a service charge. The service charge will cover minor repairs (major repairs will be subject to addition charges for parts and labor).

This warranty is in lieu of and excludes all other warranties, expressed or implied, and in no event shall Valcom, Inc. be liable for any anticipated profits, consequential damages, loss of time or other losses incurred by the buyer in connection with the purchase, operation or use of the product. This warranty specifically excludes damage incurred in shipment. In the event a product is received in damaged condition, the carrier should be notified immediately. Claims for such damage should be filed with the carrier involved in accordance with the F.O.B. point.

> Headquarters: Valcom, Inc. 5614 Hollins Road Roanoke, VA 24019-5056 Phone: (540) 563-2000 FAX: (540) 362-9800

Free Manuals Download Website <u>http://myh66.com</u> <u>http://usermanuals.us</u> <u>http://www.somanuals.com</u> <u>http://www.4manuals.cc</u> <u>http://www.4manuals.cc</u> <u>http://www.4manuals.cc</u> <u>http://www.4manuals.com</u> <u>http://www.404manual.com</u> <u>http://www.luxmanual.com</u> <u>http://aubethermostatmanual.com</u> Golf course search by state

http://golfingnear.com Email search by domain

http://emailbydomain.com Auto manuals search

http://auto.somanuals.com TV manuals search

http://tv.somanuals.com