



# *IXP12xx ATM OC12/Ethernet IP Router Example Design*

**Performance and Headroom Analysis**

---

*April, 2002*

Information in this document is provided in connection with Intel products. No license, express or implied, by estoppel or otherwise, to any intellectual property rights is granted by this document. Except as provided in Intel's Terms and Conditions of Sale for such products, Intel assumes no liability whatsoever, and Intel disclaims any express or implied warranty, relating to sale and/or use of Intel products including liability or warranties relating to fitness for a particular purpose, merchantability, or infringement of any patent, copyright or other intellectual property right. Intel products are not intended for use in medical, life saving, or life sustaining applications.

Intel may make changes to specifications and product descriptions at any time, without notice.

Designers must not rely on the absence or characteristics of any features or instructions marked "reserved" or "undefined." Intel reserves these for future definition and shall have no responsibility whatsoever for conflicts or incompatibilities arising from future changes to them.

The IXP12xx ATM OC12/Ethernet IP Router Example Design may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Contact your local Intel sales office or your distributor to obtain the latest specifications and before placing your product order.

Copies of documents which have an ordering number and are referenced in this document, or other Intel literature, may be obtained from:

Intel Corporation

[www.intel.com](http://www.intel.com)

or call 1-800-548-4725

\*Other brands and names are the property of their respective owners.

Copyright © Intel Corporation 2002

# IXP12xx ATM OC12/Ethernet IP Router Example Design Performance and Headroom Analysis

## OVERVIEW

This documents details the performance and headroom analysis done on the IXP12xx ATM OC12 / Ethernet IP Router Example Design. It covers the general performance aspects of the protocols; cycle and instruction budgets; testing under different workloads; and performance measurements in both, simulation and hardware environments.

This document also attempts to analyze the amount of headroom available in this design for customers to add additional features by providing microengine and memory utilization metrics.

Three different configurations are supported:

One ATM OC-12 port & eight 100Mbps Ethernet ports	For use with the IXP1240/1250 with hardware CRC capability
Four ATM OC-3 ports & eight 100Mbps Ethernet ports	Similar to the above configuration (requires the IXP1240/50), except that it uses four OC-3 ports.
Two ATM OC-3 ports & four 100Mbps Ethernet ports	For use with the IXP1200 (which does not have hardware CRC capability). Instead, CRC computation is performed by two microengines (thus the reduced data rates).

Since in each configuration aggregate Ethernet port bandwidth exceeds aggregate ATM port bandwidth, ATM port bandwidth is the limiting *external* factor. This example design supports full-duplex, full-bandwidth ATM communication on all available ATM ports.

The design is able to simultaneously transmit and receive any traffic pattern on all available ATM ports at line rate. Line rate means that no idle cells should appear on the ATM links. Furthermore, no ATM PHY FIFO overflows or Ethernet MAC FIFO overflows or underflows should occur.

## MEASUREMENT ENVIRONMENT

Simulation and hardware performance testing was performed under the following conditions:

- o 232 MHz IXP1240 with an 80 MHz IX Bus  
(IXP1200 measurements do not use the hardware-CRC on the IXP1240)
- o 133 MHz SDRAM – ‘-75’ speed-grade  
(some results for 143 MHz (‘-7E’ speed-grade) are also provided where indicated)


### *Alternate DRAM Timing*

The project ships with two FLASH files for two different DRAM speed grades. atm\_ether\tools\flash contains files for 133MHz (-75) and 143 MHz (-7E) DRAM. Most measurements were repeated with both settings to illustrate the sensitivity of the design to DRAM performance. Where not specifically mentioned in this document, the slower 133MHz settings were used.

## KEY WORKLOADS & APPROACHES TO TESTING THE EXAMPLE DESIGN

### *Protocol Performance of IP over ATM vs. Ethernet*

Figure 1 details the protocol processing required to carry an IP packet over ATM and Ethernet. .

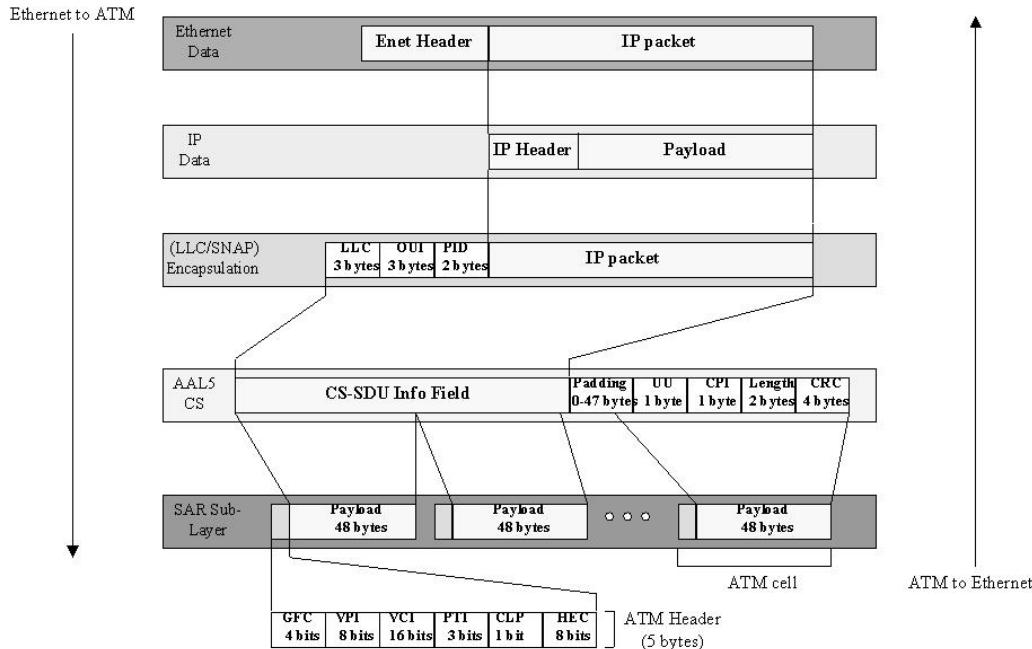

**Figure 1 – Protocol Processing**


Figures 2 and 3 show that as the size of the IP packet varies so do the efficiencies of ATM and Ethernet. This section details those efficiencies and the resulting performance implications

### *Single Cell PDU Workload*


Single-cell PDUs result from IP packets of size 20 to 32 bytes – for example UDP packets with up to 4 payload bytes (8 bytes of LLC/SNAP plus 8 bytes of AAL5 trailer are included with the IP packet in the 48-byte cell payload). Adding a 4-byte ATM cell header plus 1-byte HEC results in a 53-byte cell. SONET overhead transparently adds about another 2 bytes/cell to the wire-time such that its total cost is 55-bytes in terms of a 155 or 622 Mbps ATM link.

When the same packet is carried over Ethernet, it expands to consume a minimum-sized 64-byte frame. Ethernet then adds at least 960ns of inter-packet gap (12-bytes), plus a preamble (8-bytes). The total packet cost is 84-bytes on a 100Mbps Ethernet link.

The result is that ATM is significantly more efficient than Ethernet in terms of Mbps for carrying very small PDUs. Every Mbps of single-cell-PDUs on the ATM link requires (84/55) Mbps on the matching Ethernet link(s).

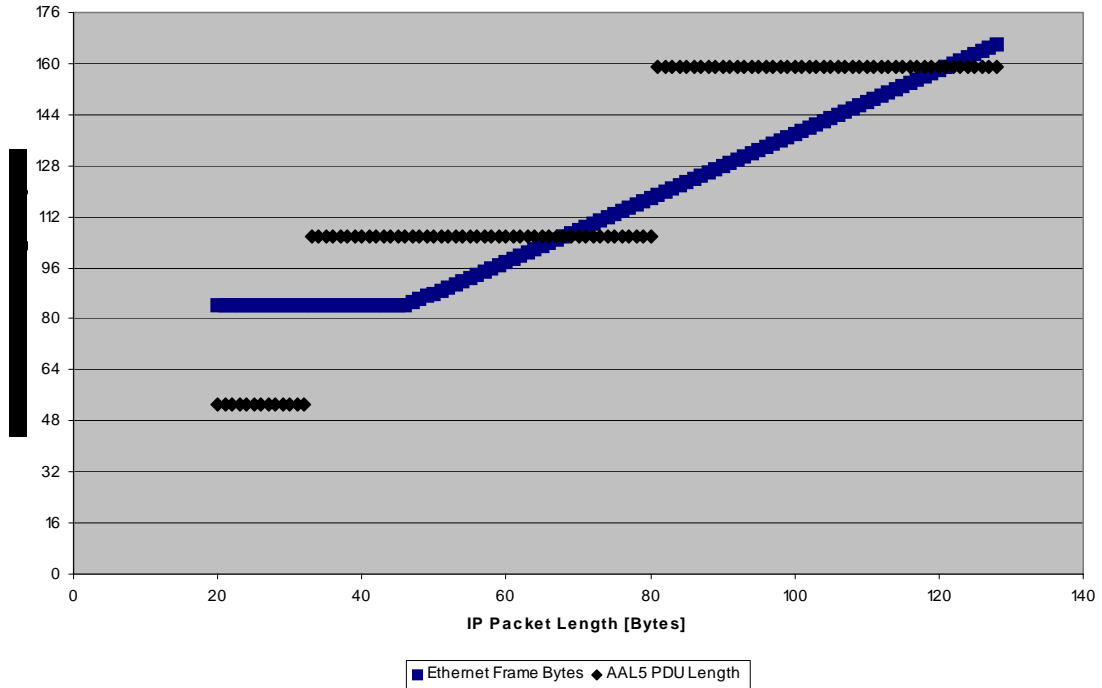

**Figure 2 – Frame and PDU Length versus IP Packet Length**

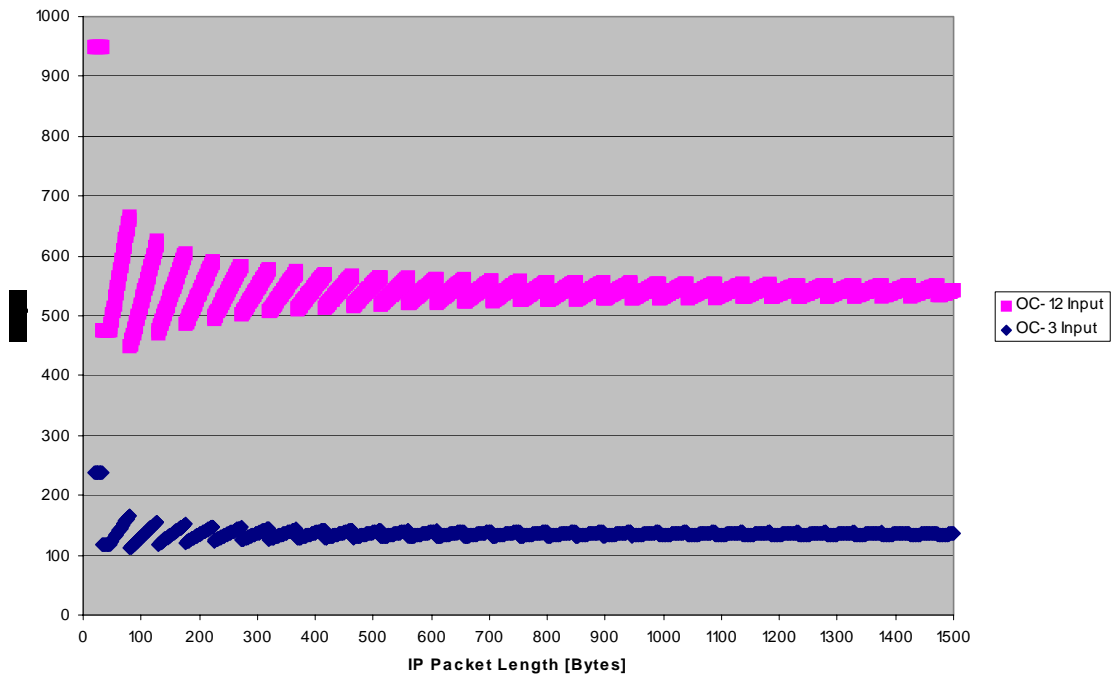

**Figure 3 – Expected Ethernet Transmit Bandwidth**

As shown graphically in Figure 3, 622Mbps of single-cell-PDU input requires  $622 * (84/55) = 949$  Mbps of Ethernet output.

This example design supplies 800Mbps of Ethernet bandwidth (IXP1240 configurations), so under a single cell/PDU workload the design can be expected to transmit Ethernet at line rate, and to discard the excess ATM input. In the reverse direction, if Ethernet data is received at wire rate (even with all 8 ports running at wire-rate), ATM transmit will not be saturated under a single cell/PDU workload.

### *Multiple Cells/PDU Workload*

Following Figure 2 from left to right, it is clear that once a PDU size overflows from one cell into two, Ethernet becomes more efficient in terms of Mbps.

When the packet completely fills two or three cells, ATM is again more efficient, but not by much. For example, two full cells require  $622(118/110) = 666$  Mbps; and three full cells require  $622/(166/159) = 625$  Mbps of Ethernet bandwidth for 622Mbps of ATM bandwidth. These numbers are well below the 800Mbps of Ethernet bandwidth available in the example configuration.

Thus for multi-cell/PDU workloads, this design has more Ethernet bandwidth available than ATM bandwidth, and excess Ethernet input will be discarded. In the reverse direction, Ethernet transmit bandwidth will not be exceeded even if all ATM ports receive data at wire-rate (Figure 3).

While this design supports any IP packet size between 20 and 1500 bytes, 40 byte packets are expected to be the most common. 40-byte packets corresponds to a 20-byte IP header plus a 20-byte TCP header, with no payload. 40-byte IP packets form AAL5 PDUs that consume 2 ATM cells.

The largest PDU supported by the design contains a 1500-byte packet. This packet is carried by a 1518-byte Ethernet frame or by a 32-cell AAL5 PDU.

## **CYCLE AND INSTRUCTION BUDGETS**

### *Cycle Budgets to support Line Rates*

OC-12 line rate is 622Mbps, but SONET overhead reduces it to 599Mbps available to ATM cells.  $53 \text{ bytes/cell} * 8 \text{ bits/byte} / 599 \text{ Mb/sec} = 708 \text{ ns/cell}$ . So  $232\text{MHz} * 708 \text{ ns/cell} = \underline{\underline{164 \text{ cycles/cell}}}$ .

OC-3 line rate is 155Mbps, but SONET overhead reduces it to 149Mbps available to ATM cells.  $53 \text{ bytes/cell} * 8 \text{ bits/byte} / 149 \text{ Mb/sec} = 2.85 \text{ us/cell}$ . So  $232\text{MHz} * 2.85 \text{ us/cell} = \underline{\underline{660 \text{ cycles/cell}}}$ .

Ethernet has a variable sized frame, and thus a variable per-frame cycle budget. The worst-case is minimum-sized 64-byte frames, thus they are the focus for per-frame calculations here. A 64-byte frame actually occupies 84 bytes on the wire.  $\{(12 \text{ byte Inter Packet Gap}) + (8 \text{ byte preamble}) + (46 \text{ byte IP packet}) + (14 \text{ byte Ethernet Header}) + (4 \text{ byte Ethernet FCS}) = 84$

bytes/minimum frame}.  $84 \text{ bytes/frame} * 8 \text{ bits/byte} / 100\text{Mb/sec} = 6.72 \text{ usec/frame}$ .  $232\text{MHz} * 6.72 \text{ usec/frame} = \underline{1559 \text{ cycles/frame}}$

These cycle budgets specify how frequently a cell or frame goes over the wire. If multiple threads handle multiple frames on the same wire, then the budgets are multiplied accordingly. For example, the OC-12 cycle budget is 164 cycles/cell, but since the four threads on a single microengine can work on four frames simultaneously, the equivalent per-thread cycle budget becomes  $4 * 164 \text{ cycles}$ , or approximately 660 cycles/frame. That is, four threads working on 4 different cells can each take up to 660 cycles to process a cell and still keep up with line rate.

This per-thread per-packet cycle budget is independent of how the thread consumes the cycles – it specifies only the maximum time (in cycles) between the beginning and end of packet processing. The cycles may be used for instruction execution, aborted instructions due to branches, microengine stalls due to command queue pushback, or idle cycles. Changes in any of these uses of time can cause a thread to meet or exceed its cycle budget.

The Developer's Workbench IX Bus Device Simulator is typically configured to show performance in Mbps based on frames/sec. However, it can also be configured to display cycles/frame, which is useful in tuning a design to reach cycle budgets.

#### *Developer's Workbench IX Bus Simulator – Bounded and Unbounded Wire Rates*

Simulations can be run with ports “bounded” or “unbounded” to the wire rate. Simulations run with ports “bounded” to wire rate will always show exactly the correct cycle budget/frame – because it is bound to the desired wire rate. It is also useful to run a simulation with the ports “unbounded” to wire-rate (infinite bandwidth on the wire). This means that on the receive side there is always data waiting on the wire, and on the transmit side the wire is always ready to accept more data. If the design is able to run faster than wire-rate, then setting the IX Bus Device Simulator to display in cycles/frame can be useful to relate that to instructions.

This technique was used to measure the OC-12 Receive Microengine over several workloads against its 164 cycles/cell budget. The 8 interleaved VC workloads were used to make sure that the VC-cache experienced a 100% miss rate. Figure 4 shows the results for both the –75 and –7E DRAM speed grades.

<u>Cells/PDU</u>	<u>Virtual Circuits</u>	<u>Cycles/Cell –75</u>	<u>Cycles/cell –7E</u>
1*	1	154.6	137.9
1*	4 random	163.9	149.8
1*	8 interleaved	172.8**	159.0
2	1	161.0	137.1
2	8 interleaved	158.4	149.2
32	1	152.5	141.9
32	8 interleaved	131.5	127.4

\* Simulations show that ATM Receive can handle the 1-cell/PDU workload, but that the IP Router in the next pipeline stage falls behind.

\*\* For –75 DRAM, the ATM Receive cycle budget is exceeded for a workload of single-cell, interleaved PDUs.

**Figure 4 – OC-12 Unbounded ATM Receive simulations versus 164 cycle budget**

One issue with running simulations unbounded to wire-rate is that it can hide errors because there is no concept of device overflows or underflows. Further the design can become un-balanced, say for example if an efficient receiver races ahead of the rest of the design, hogging shared system resources and potentially penalizing another part of the system.

Another approach is to simulate bounded, but to bind to a wire-rate that is faster than the actual wire-rate. The disadvantage of this technique is that it is an iterative process. To discover the maximum performance one must raise the wire rate until the design fails to keep up, and then one must lower it until the design runs correctly without any overflows or underflows.

## **SIMULATION MEASUREMENT PROCEDURE AND RESULTS**

In the simulation environment, 29, 40, and 1500 byte packets are measured using the Developer's Workbench IX Bus Device Simulator's streams facility. The workloads are homogeneous, in that the same sized packets are sent into both Ethernet and ATM ports.

To measure the performance of the design, the simulation is run with the Ethernet ports bounded to 100Mbps, and the ATM ports bounded to 155 or 622 Mbps, as appropriate. The simulator is set to stop if it detects a device overflow or underflow.

Full-bandwidth input streams of the specified packet size are simultaneously applied to all ATM and Ethernet ports present in the configuration for at least 1M cycles.

Upon completion of the simulation run, the line rates in the IX Bus Device Status window are observed. The Ethernet ports should be receiving at 100 Mbps each. The ATM port(s) should be receiving at 622 (or 155 Mbps each). For 29-byte packets, the Ethernet side should transmit at wire-rate and discard excess ATM input. For 40 and 1500-byte packet workloads the ATM side should transmit at wire-rate and discard excess Ethernet input.

No device overflows or underflows were detected during the simulation.

### *Simulated 29-byte packet performance<sup>1</sup>*

For the OC-12 and 4xOC-3 configurations running the 1 cell/PDU workload, the simulation stops with a watch-point when the MSGQ from the ATM Receive Microengine to the IP Route Microengine fills to capacity. This means that the IPR Microengine is not able to keep up with the 1 lookup/cell workload (1.4M lookups/sec). Upon disabling the watch-point and completing the 1M cycle simulation, the number of PDUs dropped due to the ATM\_RX\_IPR\_FULLQ is compared to the total number of cells received via ATM. This shows that the IP Router Microengine drops 19-22% of the cells received via ATM. Conversely, it shows that the IP Router Microengine is routing 78-81% of the 1.4M cells/sec input, or about 1.1M routes/second.

While this observation shows that under this workload the IP Router does not keep up with the input, it shows that for a workload with 2-cell PDUs, the IP Router has the capability of routing  $(1.1 - 1.4/2) = 400K$  routes/second more than the maximum 700K routes/second required.

---

<sup>1</sup> Simulations for 29-byte, 40-byte, and 1500-byte packet loads were run using 133 MHz memory (-75).



Both the OC-12 and 4xOC-3 configurations experience an ATM overflow after 1M cycles. This indicates that under this system workload, the receiver is not keeping up with the wire, but has dropped a cell in the first 6,000 cells.

### *Simulated 40-byte and 1500-byte packet performance<sup>2</sup>*

The OC-12 and 4xOC-3 configurations perform at ATM wire-rate under full-duplex, full-bandwidth 40-byte and 1500-byte packet loads.

## **HARDWARE MEASUREMENT PROCEDURE AND RESULTS**

While simulation provides a high degree of visibility into the design, there are several important benefits to measuring on hardware:

1. The ability to do experiments on large numbers of packets. The simulator receives about 10 cells/second, whereas the hardware can receive OC-12 data at 1.4M cells/second. Thus events that take a long time to occur on the simulator occur almost immediately on the hardware.
2. Unplanned error conditions occur regularly on the hardware due to hot plugging cables, optical and electrical noise, mis-configured lab equipment or random error injection via lab equipment, etc – and the design must handle them correctly.
3. The Transactor simulator does not model DRAM refresh overhead, and so configurations that are sensitive to DRAM bandwidth will notice a small performance hit on the hardware versus simulation.

To measure the design in the lab, an ADTECH AX/4000 is attached to the ATM ports, and a Smartbits 600 is attached to the 8 Ethernet ports.

Both pieces of equipment simultaneously generate traffic (at line-rate), and also observe the data that is being transmitted through the system from the other end of the design. Example AX/4000 sequence files are included in the project under atm\_ether\tools\AX4000.

After the experiment, the Octal MAC and the IXF6012 “Volga” PHY counters are checked for evidence of underflows or overflows. Specifically, for the PHY, idle cells sent or received are searched for, as these would indicate that the ATM links were not fully utilized.

The Counters\_print() command at the VxWorks\* command line also displays if the microcode discarded any packets, and why.

### *Hardware Measurement Results*

Only the OC-12 configuration results are detailed here, as no WAN daughter-card was available with 4xOC-3 ports.

ATM Transmit Rate is expressed as a percentage of OC-12 wire rate, as received and reported by the AX/4000. IXF6012 Transmit Idle cells are reported by “\_VolgaGetChanCounters” to report

---

<sup>2</sup> Simulations for 29-byte, 40-byte, and 1500-byte packet loads were run using 133 MHz memory (-75).

the number of times the PHY was not fed a cell in time to keep the wire busy, and thus had to manufacture an idle cell. The number reported here is from the 2<sup>nd</sup> counters query when 2 “\_VolgaGetChanCounters” are issued on the same line at the VxWorks prompt (this is because “\_VolgaGetChanCounters” prints out the delta between a previous invocation and the present invocation). IXF6012 Overflows are measured the same way, and they are generally the result of the StrongARM\* core overhead involved in running the “\_VolgaGetChanCounters” command itself. “Ethernet Transmit Kframe/sec” captures the lowest and highest results as received and reported by SmartBits600 over the 8 Ethernet ports.

The test measurements are repeated with a variable number of full-bandwidth Ethernet ports driving the design. The test with “0” Ethernet input ports shows the maximum possible ATM-to-Ethernet performance, that is, when there is no Ethernet-to-ATM traffic to load down the system. This is effectively a half-duplex ATM-to-Ethernet forwarding measurement. More Ethernet input ports are added to show how the system handles the increase in load, even though for 40 and 1500-byte packet measurements, 6-8 Ethernet ports over-subscribe available ATM transmit bandwidth.

#### *Hardware 29-byte packet performance*

Ethernet Input Ports	ATM Transmit Rate [%]	IXF6012 Transmit Idle	ATM Receive Ports	IXF6012 Overflows	Ethernet Transmit KFrame/s	Ethernet Transmit [MB/s]
8	84	N/A	1	4000	132 – 138	8 – 9
7	73	N/A	1	1000	127 – 147	8.5 – 9.5
6	63	N/A	1	0	133 – 148	8.5 – 9.5
0	0	N/A	1	0	148.8	9.5

**Figure 5 – Single-cell/PDU Performance using 133MHZ DRAM**

The bottom entry in the table with 0 Ethernet Input Ports shows half-duplex performance – i.e. what the design does when it is only forwarding this workload from ATM to Ethernet. The result is wire-rate ATM Receive and Ethernet Transmit performance, and the StrongARM core can run “\_VolgaGetChanCounters” without disturbing the data plane at all. As discussed above, this workload is attempting to transmit 949Mbps out the 800Mbps of Ethernet ports. Indeed, 8 Ethernet ports X 148,808 frames/sec = 1.19M packets/second; while the ATM Receive packet rate is 1.4M packets/sec. Looking at the microengine counters, The ratio between the packets dropped due to full Ethernet Transmit queues and the packets dropped due to a full IP Router input MSGQ shows that about 37% of the dropped packets are due to Ethernet transmit queues being full, and the remaining 63% are due to the IP Router Microengine not being able to route 1.4M packets/second. This is consistent with the simulation result for the same workload that showed the IP router couldn’t keep up with 1.4 routes/second.

Transmitting from Smartbits on 6 full-bandwidth Ethernet ports impacts Ethernet Transmit performance, but only on a couple of ports. But this is not enough Ethernet input to saturate ATM Transmit.

Increasing the Ethernet workload to 7 ports, and then 8 ports, increases the ATM Transmit performance, but with the ratio of 949Mbps Ethernet to 622Mbps ATM, this is still not enough Ethernet input to saturate the ATM Transmitter. Also, Ethernet Transmit performance starts to

degrade in these scenarios, and the design becomes subject to ATM overflows from running “\_VolgaGetChanCounters”.

Ethernet Input Ports	ATM Transmit Rate [%]	IXF6012 Transmit Idle	ATM Receive Ports	IXF6012 Overflows	Ethernet Transmit KFrame/s	Ethernet Transmit [MB/s]
8	84	N/A	1	<b>0</b>	<b>138 - 147</b>	<b>8.8 – 9.4</b>
7	73	N/A	1	<b>0</b>	<b>142 - 148</b>	<b>9.0 – 9.5</b>
6	63	N/A	1	0	<b>144 – 148</b>	<b>9.2 – 9.5</b>
0	0	N/A	1	0	148,808	9.5

**Figure 6 – Single-cell/PDU Performance using 143MHz DRAM**

Repeating the same measurements for 143 MHz DRAM results in the same ATM transmit bandwidth in all cases (Figure 6). Interference from “\_VolgaGetChanCounters” is gone however, even in the 8 port configuration. Ethernet Transmit performance is slightly better, but still sub-wire-rate in the 8 port configuration. When there is no Ethernet input at all, the ratio between packets dropped by the IP Router versus full Ethernet transmit queues improved such that the Ethernet Transmit queues drop 45% and the IP Router drops only 55% of the excess input.

#### *Hardware 40-byte packet performance*

Ethernet Input Ports	ATM Transmit Rate [%]	IXF6012 Transmit Idle	ATM Receive Ports	IXF6012 Overflows	Ethernet Transmit KFrame/s	Ethernet Transmit [MB/s]
8	97	30,000	1	700	88,300	5.6
7	100	1,500	1	69	88,300	5.6
6	100	700	1	0	88,300	5.6
<b>5</b>	<b>100</b>	<b>0</b>	<b>1</b>	<b>0</b>	<b>88,300</b>	<b>5.6</b>
4	84	N/A	1	0	88,300	5.6

**Figure 7 – Two-cell PDU Performance on 133MHZ DRAM**

For the 40-byte (2 cell/PDU) workload there are half as many IP lookups/second as are required in the 29-byte (1 cell/PDU) workload. As expected, the IP Router was able to keep up with this workload and didn't drop any packets.

For five Ethernet input ports, the design performed perfectly, and “\_VolgaGetChanCounters” did not cause any dropped cells.

Reducing the Ethernet input to 4 ports did not allow enough input to saturate ATM Transmit. Increasing the Ethernet input ports to 6, 7 and 8 allowed over-subscription in the Ethernet to ATM forwarding direction, as evidenced by the ATM Transmit idle cells and ATM Receive overflows. Indeed, even under nominal conditions, the 8 port input configuration was able to drive only 97% of the ATM wire.

For this packet size, Ethernet is more efficient than ATM, and the Ethernet transmitter cannot be expected to be driven at wire rate. Indeed, under nominal conditions the Ethernet transmitter performed perfectly for all tested configurations.

Ethernet Input Ports	ATM Transmit Rate [%]	IXF6012 Transmit Idle	ATM Receive Ports	IXF6012 Overflows	Ethernet Transmit KFrame/s	Ethernet Transmit [MB/s]
<b>8</b>	<b>100</b>	<b>0</b>	<b>1</b>	<b>0</b>	<b>88,300</b>	<b>5.6</b>

**Figure 8 – Two-cell/PDU Performance on 143MHZ DRAM**

Using 143 MHz DRAM, the 40-byte (2-cell/PDU) workload performed perfectly, even with 8 Ethernet ports over-subscribing the ATM Transmitter (Figure 8). “\_VolgaGetChanCounters” recorded zero ATM Transmit Idle cells and zero ATM Receive overflows.

This illustrates the sensitivity of the design to DRAM speed grade selection.

#### *Hardware 1500-byte packet performance*

Ethernet Input Ports	ATM Transmit Rate [%]	IXF6012 Transmit Idle	ATM Receive Ports	IXF6012 Overflows	Ethernet Transmit KFrame/s	Ethernet Transmit [MB/s]
8	100	2	1	500	5,450	8.33
7	100	0	1	200	5,518	8.37
<b>6</b>	<b>100</b>	<b>0</b>	<b>1</b>	<b>0</b>	<b>5,518</b>	<b>8.37</b>
5	92	N/A	1	0	5,518	8.37

**Figure 9 – 32-cell/PDU Performance on 133MHz DRAM**

Results for 1500-byte packets (32-cells/PDU) were similar to the 2-cell case. The design worked flawlessly with six input Ethernet ports. Five ports was not enough to drive ATM to saturation, and the design degraded slightly as it was over-subscribed by adding the 7<sup>th</sup> and then 8<sup>th</sup> Ethernet input port (Figure 9).

Ethernet Input Ports	ATM Transmit Rate [%]	IXF6012 Transmit Idle	ATM Receive Ports	IXF6012 Overflows	Ethernet Transmit KFrame/s	Ethernet Transmit [MB/s]
<b>8</b>	<b>100</b>	<b>0</b>	<b>1</b>	<b>0</b>	<b>5,517</b>	<b>8.37</b>

**Figure 10 – 32-cell/PDU Performance on 143 MHz DRAM**

Analogous to the 2-cell/PDU case, the 32-cell/PDU case performed perfectly using 143 MHz DRAM, even in the face of over-subscription with 8 Ethernet input ports and “\_VolgaGetChanCounters” running on the core (Figure 10).

## **StrongARM CORE PERFORMANCE**

This example design sends exception cells, PDUs and frames to the StrongARM core. It uses up to 4 message queues for this purpose – one for each of the microengines that can send data to the core. The core is alerted by an interrupt when data is put into the core message queues.

### *Queue to Core Measurement Technique*

The performance of the queue-to-core path can be measured by modifying a nominal input data stream such that the entire stream is forwarded to core. For example, changing the IP version in the IP header from 4 to 5 will cause the packets to be forwarded to the core.

The lab equipment sends this data stream at a known rate, and the amount of it that gets to the core is measured. Both the StrongARM core and the microcode count how many packets successfully reach the core. The microcode also counts how many packets failed to get queued to the core because the queue was full. In addition, the PHY or MAC count any packets that are dropped before they were received by the microengines. The ratio of packets that made it to the core over the total packets sent is multiplied by the input wire-rate to arrive at the queue to core success rate.

### *ATM Queue to Core Throughput*

For ATM management cells, and PDUs with IP exceptions, the core interrupt service routine schedules a user-context interrupt handler that consumes the appropriate message queue. Then it simply re-cycles the buffer descriptors by pushing them back onto the freelist without further processing.

When faced with a stream of 100% exception PDUs, the IP Router Microengine is able to send over 200,000 PDUs/second to the core by this method. This is over half of OC-3's 353,207 cells/second link capacity. The throughput of this communication method peaks at over 320,000 cells/second, but at that point over 10% of the input streams is discarded due to full queues to core, and the VxWorks interrupt handler sub-system complains about ring buffer overflow as it attempts to schedule the user-context interrupt handlers.

### *Ethernet Queue to Core Throughput*

Ethernet exception frames are sent to the StrongARM core via the same message queue technique as ATM exceptions. Again, the interrupt service routine schedules a user-context interrupt handler for every interrupt. However, the Ethernet core handler copies the packets into the VxWorks pseudo-Ethernet driver and sends them up the VxWorks IP stack before re-cycling the buffer descriptors.

When forwarding exception packets to the VxWorks IP stack this way, the system is able to send 37,500 frames/second to the core. This is about 1/3 of the 148,810 frames/second on a 100Mbps Ethernet link (minimum-sized Ethernet frames).

If the packets are simply discarded by the user-context interrupt handler instead of being copied into VxWorks, then the success rate rises to over 145,000 frames/second – nearly full 100Mbps link bandwidth. The system is able to send more packets to the StrongARM core – rising to over 500,000 frames/second when faced with 4 ports at full bandwidth. However, the more it is over-subscribed, the higher percentage of packets the system drops – particularly as VxWorks succumbs to ring buffer overflow at about 200,000 frames/second.

## RESOURCE UTILIZATION AND HEADROOM ANALYSIS

This section details system resource utilization, including per-microengine resources such as registers and microstore instructions; as well as shared resources such as Scratchpad RAM, SRAM, and DRAM. The memory utilization is shown using the default system memory map as shipped.<sup>3</sup> One of the ATM utilities, `config_print()`, prints out the Scratchpad RAM, SRAM, and DRAM address maps to show the memory map in detail. Almost all of the data structure sizes in these memories are configurable.

### *Microengine Register and Microstore Headroom*

Register utilization is measured by using the `free_register_test()` macro to soak up all available registers. This is an iterative process – the macro either prints out how many registers it successfully allocated, or the assembler quits because it failed to allocate the requested registers. In this analysis this macro is applied at the global level, so the result is worst-case. It is generally possible to allocate more registers if their scope does not overlap the deepest scope in the design.

Microengine	Available General Purpose Registers	Available SRAM Transfer Registers	Available SDRAM Transfer Registers	Available Threads	Available Microstore Instructions
<b>Configuration 1 – IXP1240 1xOC-12, 8xEthernet</b>					
ATM Receive	2	0	5	0	1514
IP Route	11	4	0	0	1677
Ethernet Receive (2 microengines)	1	0	0	0	1363
	1	0	0	0	1363
ATM Transmit	12	3	2	1	1728
Ethernet Transmit	5	0	6	0	1235
<b>Configuration 2 – IXP1240 4xOC-3, 8xEthernet</b>					
ATM Receive	12	0	6	0	1724
IP Route	11	4	0	0	1677
Ethernet Receive (2 microengines)	1	0	0	0	1348
	1	0	0	0	1348
ATM Transmit	8	1	2	0	1716
Ethernet Transmit	5	0	6	0	1235
<b>Configuration 3 – IXP1200 2xOC-3, 4xEthernet</b>					
ATM Receive & IP Route	9	0	0	0	1403
Ethernet Receive	1	0	0	0	1370
CRC Check	12	3	2	0	1811
CRC Generate	16	0	2	0	1847
ATM Transmit	8	1	4	2	1805
Ethernet Transmit	5	0	6	0	1235

**Figure 12 – Microengine register and microstore headroom**

<sup>3</sup> So that a single version of the ATM utilities in the foreign model DLL and the vxWorks utilities could handle any configuration, all three port configurations (IXP1240 1xOC12, IXP1240 4xOC3, and IXP1200 2xOC3) use the same memory map.

Microstore utilization can be observed by opening a microengine list window with line numbers enabled, and recording the last line number plus 1. Available instructions = 2048 – used instructions.

Figure 12 shows the results for each of the three configurations.

The CRC Check and CRC Generate microengines apply only to the IXP1200 configuration. In the IXP1200 configuration the ATM Receive and IP Route functions run on the same microengine. See the Application Note for this example design for more detail on microengine and thread allocation.

### *Scratchpad RAM Capacity*

There are 1024 32-bit Scratchpad RAM locations on-chip, and just over 50% of them are available.

This design uses 256 locations (25%) for statistics counters, including 16 counters for each of the 12 ports; plus global counters.

7 message queues consume 112 entries (11%), and a table to map port numbers to MAC addresses consumes 16 more entries. There are some smaller users of Scratchpad RAM locations that cause some address map fragmentation, but there are basically two blocks of about 256 entries available at 0x100 and 0x300.

### *SRAM Capacity*

The IXM1240 Network Processor Base Card comes with 8MB of SRAM. This design is currently configured so it uses less than 4MB, leaving over 50% available.

As various configurations of this project may be integrated with other code that utilizes memory below 0x20000 (.5MB), the area below 0x20000 was simply left alone to avoid potential address map conflicts.

The SRAM portion of the IP Lookup Table begins at 0x20000, and can grow almost to 0x80000, (1.5MB).

For convenience, the same utilities are compiled to run on both Software and Hardware CRC configurations. Thus the current project taxes all configurations with a 64K location (256KB) CRC-32 lookup table.

The VC Table occupies 0x50000 (320K) locations, corresponding to a 64K entry table with 5 locations per entry. The VC Miss Table has 8K additional entries consuming 0xA000 locations. All totaled, the VC tables consume 360K locations (1.4MB).

The system is configured with 16K Buffer Descriptors at 4 words each, consuming 64K locations (265KB).

### *SDRAM Capacity*

The IXM1240 Network Processor Base Card comes with 128MB of SDRAM. The project is configured to use less than 64MB: 32MB of Packet Data Buffers, 16MB for VxWorks, and the balance for IP Route Table Entries. This leaves over 50% available.

The IP Route Table Entries live at 0x8100, simply because they do so by default in all the example designs.

Associated with each of the 16K Buffer Descriptors in SRAM is a 2KB Data Buffer in SDRAM, for a total of 32MB of Data Buffers in SDRAM.

Note that the Data Buffers span the multiple SDRAM bank selects as described in the IXP1200 Hardware Reference Manual. Further, the descriptor freelist is “mixed” at initialization time to give the SDRAM controller the opportunity to access addresses from the multiple DRAM banks. See the appendix (“Buffer Allocation in DRAM”) for more information on “mixing” the freelist.

VxWorks consumes the top 16MB of DRAM.

### *SRAM and SDRAM Bandwidth*

Bandwidth measurements are taken on the Transactor simulator using the full-duplex, full-bandwidth 40-byte packet workload on a 2Mcycle simulation. Percent idle cycles are 100% minus the active percentage shown in the Developer’s Workbench Statistics/Summary box.

Configuration	SRAM % Idle	SDRAM % Idle
IXP1240 1xOC-12 8x100Mbps Ethernet	65.2	42.9
IXP1240 4xOC-3 8x100Mbps Ethernet	57.0	43.3
IXP1200 2xOC-3 4x100Mbps Ethernet	43.0	57.5

**Figure 13 – SRAM and SDRAM bandwidth headroom**

The IXP1200 configuration handles ½ the throughput of the IXP1240 configurations, but it has much less SRAM bandwidth available. This is because it uses a CRC-32 lookup table in SRAM.

The two IXP1240 configurations handle exactly the same bandwidth, and their SDRAM usage is essentially the same. The 4xOC-3 configuration uses more SRAM bandwidth, however, because its ATM Transmitter uses an array of SRAM Buffer Descriptor Queues (BDQ) in SRAM, while the simpler OC-12 configuration uses a pair of Message Queues (MSGQ) in Scratchpad RAM. The OC-12 configuration’s VC Cache may also reduce accesses to the VC Table in SRAM.

From a high-level, one could say that the IXP1200 configuration is SRAM bandwidth limited; and that the IXP1240 configurations are DRAM bandwidth limited. This can be explored further with unbounded simulations, which allow the design to not be limited by wire-rate. Additional SRAM and SDRAM accesses can be added to the design to observe the impact on performance; and the design can be run on different SDRAM speed grades.



## APPENDIX

### *Buffer Allocation in DRAM*

The microengines in this example design uses two DRAM command queues. The *ordered* queue is used by all `sdram_crc[]` commands to transfer packet data between DRAM and the receive and transmit FIFOs. The *priority* queue is used for all other microengine DRAM accesses, including access to IP lookup table entries, and modifications to packet headers.

While the instruction set mandates that the `sdram_crc[]` commands use the ordered queue, the design has the flexibility to use different queues for the other DRAM accesses. `system_config.h` defines `DRAM_QUEUE` to either "ordered", "optimize\_mem", or "priority", for this purpose. The choice of the priority queue as the default was made by comparing the alternatives for the OC-12 full-bandwidth configuration in simulation.

As described in the IXP1200 Hardware Reference Manual, the IXP12xx performs "Active Memory Optimization" to eliminate latencies when it accesses different DRAM banks. This is true even if the chip uses the ordered and priority queues as in this design. Thus there is a performance benefit if the system's DRAM accesses frequently alternate between DRAM banks.

To take advantage of this optimization, the DRAM data buffer pool is positioned to equally span multiple DRAM banks. Further, the descriptor freelist describing this pool is initialized such that subsequent buffer allocations refer to buffers from alternate DRAM banks.

## Free Manuals Download Website

<http://myh66.com>

<http://usermanuals.us>

<http://www.somanuals.com>

<http://www.4manuals.cc>

<http://www.manual-lib.com>

<http://www.404manual.com>

<http://www.luxmanual.com>

<http://aubethermostatmanual.com>

Golf course search by state

<http://golfingnear.com>

Email search by domain

<http://emailbydomain.com>

Auto manuals search

<http://auto.somanuals.com>

TV manuals search

<http://tv.somanuals.com>